


# Atualizando Firmware

## Instruções de Atualização

Para atualizar o firmware do seu rádio FRC, navegue até `http://192.168.69.1`

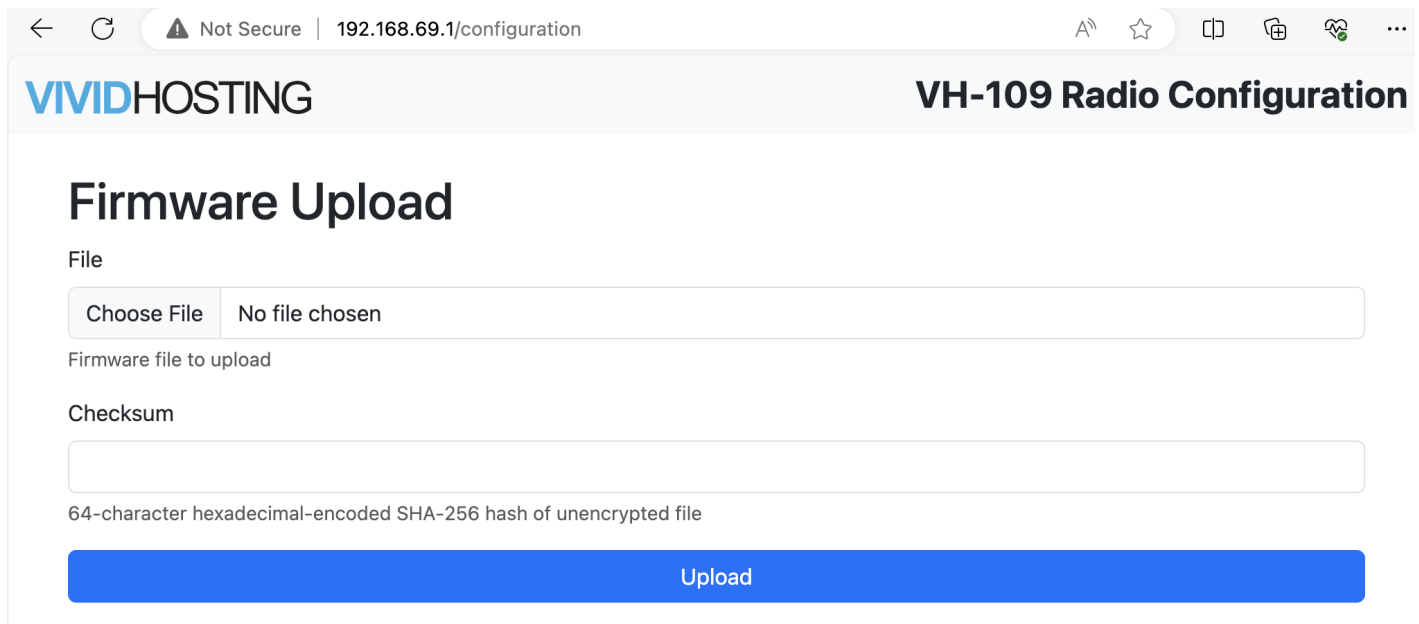

The screenshot shows a web browser window with the address bar displaying '192.168.69.1/configuration'. The page has a header with 'VIVIDHOSTING' on the left and 'VH-109 Radio Configuration' on the right. The main section is titled 'Firmware Upload'. It contains a 'File' section with a 'Choose File' button and a 'No file chosen' text. Below this is a label 'Firmware file to upload' and a text input field. The 'Checksum' section has a label and a text input field. Below the input fields is a note: '64-character hexadecimal-encoded SHA-256 hash of unencrypted file'. At the bottom of the form is a large blue 'Upload' button.

1. Selecione o arquivo de firmware desejado, o firmware pode ser encontrado na parte inferior desta página para download.
2. Insira o SHA-256 correspondente que você baixou.
3. Clique em "Upload"

O rádio levará aproximadamente 2 a 3 minutos para concluir as atualizações de firmware. Não desligue a energia durante este processo. **Podem ocorrer danos ao rádio.**

Quando a **luz PWR estiver sólida** e a **luz SYS piscar lentamente a 1 Hz**, o processo de atualização do firmware estará concluído.

Quando concluído, você receberá uma mensagem de sucesso junto com um lembrete para esperar até que a luz SYS pisque lentamente

## Firmware Upload

File

Choose File VH-109\_1.0.0-01012024.img.enc

Firmware file to upload

Checksum

372450556f983d18274cf060c04fabbf925f8a809ee1efce569f64fdac6095a4

64-character hexadecimal-encoded SHA-256 hash of unencrypted file

Upload

### Success

New firmware received and will be applied now. The radio will reboot several times. The firmware upgrade process is complete when the SYS light is slowly blinking.

## Downloads de firmware

O Firmware deve ser baixado diretamente do site do fabricante: <https://frc-radio.vivid-hosting.net/miscellaneous/firmware-releases>

Revisão #4

Criado 29 janeiro 2024 15:43:50 por Pedro Souza

Atualizado 11 setembro 2024 19:51:10 por João Vitor Loeblein